## CIS

**English** 

### Camera link I/F

29mm cubic VGA High-Speed Color CMOS PoCL Camera VCC-FC20V49PCL

# Product Specification & Operational Manual

**CIS Corporation** 

#### **Table of Contents**

			PAGE						
1.	Scope	of Application	3						
2.	Handling Precautions								
3.	Notes	on Partial Scan Mode Operation	5						
4.		ct Outline							
5.	•	ication							
	5.1.	General Specification							
	5.2.	Camera Output Signal Specification							
	5.3.	CMOS Spectral Response (Representative value)							
	5.4.	Video Output Format							
	5.5.	Camera Link Port Data Bit Assignment (Base Configuration)	10						
6.	Functi	on Settings	11						
7.	Externa	al Connector Pin Assignment	13						
	7.1.	26pins Mini Camera Link Connector 12226-1100-00 PL (SUMITOMO 3M)	13						
8.	Timing	g Chart	14						
	8.1.	Horizontal Synchronous Signal Timing	14						
	8.2.	Vertical Synchronous Signal Timing	14						
	8.2.1	Full Frame Scan Mode	14						
	8.2.2	Fixed Trigger Shutter Mode	15						
	8.2.3	Pulse Width Trigger Shutter Mode	16						
9.	Partial	Scan Mode	17						
10.	Ren	note Interface Function	18						
11.	Init	ial Settings	19						
12.	CM	OS Optical Axis Accuracy	20						
13.	Dim	nensions	21						
14.	Cas	ses for Indemnity (Limited Warranty)	22						
15.	Sen	nsor Pixel Defect	22						
16.	Product Support								

#### 1. Scope of Application

This is to describe VCC-FC20V49PCL, high-speed Color CMOS Camera. All specifications contained herein are subject to change without prior notice. Reproduction in whole or in part is prohibited.

#### 2. Handling Precautions

The camera must not be used for any nuclear equipments or aerospace equipments with which mechanical failure or malfunction could result in serious bodily injury or loss of human life. Our warranty does not apply to damages or defects caused by irregular and/or abnormal use of the product.


Please observe all warnings and cautions stated below.

Our warranty does not apply to damages or malfunctions caused by neglecting these precautions.

- Do not use or store the camera in the following extreme conditions:
  - Extremely dusty or humid places.
  - $\triangleright$  Extremely hot or cold places (operating temperature  $-5^{\circ}$ C to  $+45^{\circ}$ C)
  - > Close to generators of powerful electromagnetic radiation such as radio or TV transmitters.
  - Places subject to fluorescent light reflections.
  - > Places subject to unstable (flickering, etc.) lighting conditions.
  - Places subject to strong vibration.
- Remove dust or dirt on the surface of the lens with a blower.
- Do not apply excessive force or static electricity that could damage the camera.
- Do not shoot direct images that are extremely bright (e.g., light source, sun, etc.), and when camera is not in use, put the lens cap on.
- Follow the instructions typeapter 7, "External connector pin assignment" for connecting the camera.
   Improper connection may cause damages not only to the camera but also to the connected devices.
- Confirm the mutual ground potential carefully and then connect the camera to monitors or computers. AC leaks from the connected devices may cause damages or destroy the camera.
- Do not apply excessive voltage. (Use only the specified voltage.) Unstable or improper power supply voltage may cause damages or malfunction of the camera.

• The voltage ripple of camera power DC  $+12V\pm10\%$  shall be within  $\pm50$ mV. Improper power supply voltage may cause noises on the video signals.

• The rising time of camera power supply voltage shall be less than +10V, Max 60ms. Please avoid noises like chattering when rising.

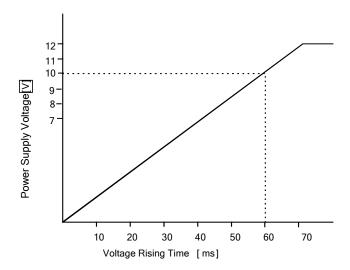

In case of abnormal operation, contact the distributor from whom you purchased the product.

#### 3. Notes on Partial Scan Mode Operation

At vertical partial scan mode, the smaller the set reading out lines, the faster the camera exposure and output operation will be. And, at the same time, power consumption will be increased.

Power consumption when the minimum partial scan line number is set will be approx. 2.4W, while it will be approx. 1.6W at full frame scan. That is about 1.5 times higher. With higher power consumption, heat will be increased as well.

We recommend promoting heat dissipation when installing our camera to your system, especially when reading out line is set between the ranges of 50lines to 1line.

For instance, installing the camera to the place under 40 degrees C ambient temperature, or installing the camera to a metalic part, would be effective.

#### 4. Product Outline

VCC-FC20V49PCL is an industrial Color high-speed digital video camera module utilizing a global shutter type, CMOS sensor. Interface of VCC-FC20V49PCL complies with power over camera link (Base Configuration) with its resolution 300K pixels. Clipping part of the image for VGA 1/4 type size, entire pixels can be read out within approx. 1/500s.

Key Fe	eatures
□ <b>F</b>	High frame rate, 502.29 fps, at full frame scan mode with Camera Link Base Configuration. Frame rate = (pixel clock) / (((horizontal output pixels/output tap number) + Horizontal Blanking) $\times$ (Vertical Output Lines + Vertical Blanking)) = $(79.99 \text{MHz}) / (((640/2) + 5) \times (480 + 10))$ = $502.29 \text{fps}$
□ 2	29mm cubic in size (excluding projection).
	PoCL 2Tap output (Base Configuration)
	RAW data output 8bit / 10bit selectable
	External Trigger
	Shutter Speed: 1/500s ∼1/50,000s
□F	Fixed Trigger Shutter Mode
	Pulse Width Trigger Shutter Mode
	Partial Scan Mode (Vertical)
	Free sample control software for evaluation purpose only is downloadable via our web.

#### 5. Specification

#### 5.1. General Specification

	Item	Specification						
		Device Type	Color CMOS					
		Effective Pixel Number	640(H) × 480(V)					
		Unit Cell Size	5.50μ m(H) × 5.50μ m(V)					
(4)	D. I. D. I	Chip Size	3.52mm(H) × 2.64mm(V) (640×5.5μ m(H) × 480×5.5μ m(V)					
(1)	Pickup Device	Image Circle	φ 4.4mm					
			2.64 (Unit: mm)					
		Pixel Clock	79.99 MHz					
(2)	Video autout forces	Horizontal Frequency	246.12kHz Pixel Clock: 325CLK					
(2)	Video output frequency	Vertical Frequency	Full Frame Scan Mode: 502.29Hz Scanning Lines: 490H					
			Partial Scan Mode 984.49Hz Scanning Lines: 250H					
			(Vertical 1/2):					
(3)	Sync. system	Internal Sync. System						
(4)	Video output standard	PoCL 2Tap Output (Base Configuration)						
(5)	Resolution	480 TV lines equivalent (\	VGA size)					
(6)	Output Format	RAW data output 8bit/10	bit selectable					
(7)	Sensitivity	F2.0 2000lx (Shutter Sp	eed: 1/500s, Gain 0dB)					
(8)	Minimum illumination	F1.4 150lx (Shutter Spe	ed: 1/500s, Gain +12dB)					
(9)	Dust or stains in	No dust or stain shall be	detected on the testing screen with setting the camera aperture at F16.					
	optical system							
(10)	Power requirements	-	age shall not be exceeded +15V.)					
(11)	Power consumption	Approx. 1.6W at ful frame						
		Approx. 2.4W at partial scan with minimum line number setting (DC DC+12V IN).						
(12)	Dimension	Refer to overall dimension	n drawing (Clause 12)					
(12)	Difficusion	H:29mm W:29mm D:29mm (excluding projection)						
(13)	Mass	Approx. 50g						
(14)	Lens mount	C mount (Refer to overa	all dimension drawing)					
(15)	Optical axis accuracy	Refer to drawing for CMO	S Optical Axis Accuracy (Clause 11)					
(16)	+0.1dB/step)							
(17)	White balance	2800K~9000K(Manual W	/hite Balance )(Guaranteed range)					
	adjustment range							
(18)	Gamma	1(Fixed)						
(19)	Shutter speed	OFF(1/500),1/750s,1/100	0s,1/1500s,1/2000s,1/2500s,1/4000s,1/5000s,1/10000s,1/15000s,					
	variable range	1/20000s,1/25000s,1/300						
(20)	Trigger shutter mode	• Fixed Trigger Shutter Mo						
,		<ul> <li>Pulse Width Trigger Shu</li> </ul>	tter Mode (Exposure time is set with the pulse width of trigger signal.)					

Item	Specification						
	UL:	Conform to UL Standard including materials and others.					
	CE: Conform to EN55022: 2006 (Class B) for Emmission						
		Conform to EN61000-6-2: 2005 for Immunity					
	RoHS:	Conform to RoHS					
(21) Safety/Quality standards		To be applied for FCC Class A Digital Device					
		This device complies with Part 15 of FCC Rules. Operation is subject to the					
	FCC:	followiong two conditions: (1) this device may not cause harmful interference, and					
		(2) this device must accept any interference received, including interference that					
		may cause undesired operation.					
		Acceleration : 98m/s² (10G)					
	Vibration	Frequency : 20~200 Hz					
(22) Durahilih	VIDIALIOII	Direction : X,Y,Z 3 directions					
(22) Durability		Testing time : 120 min for each direction					
	Shock	No malfunction shall be occurred with $980\text{m/s}^2(100\text{G})$ for $\pm \text{X}$ , $\pm \text{Y}$ , and $\pm \text{Z}$ , 6					
	SHOCK	directions. (without package)					
	Temperature	Operation guaranteed: -5°C~+45°C					
(23) Operation environment	Temperature	Performance guaranteed: 0°C~+40°C					
	Humidity	RH 20~80% with no condensation					
(24) Storago anvironment	Temperature	-25°C ~ +60°C					
(24) Storage environment	Humidity	RH 20~80% with no condensation					

VCC-FC20V49PCL \_\_\_\_\_ Rev.900-734-33


#### 5.2. Camera Output Signal Specification

It	em	Specification					
(1) Video output data	Video Output	640 (H) × 480(\	640 (H) × 480(V) At Full Frame Scan Mode				
	LVAL output	LVDS	Camera Link connector				
(2) Sync Signal I/O	FVAL output	LVDS					
(2) Sync. Signal I/O	DVAL output	LVDS					
	SP(Exposure)	LVDS					
	Polarity	POSI/NEGA Selectable					
(3) Trigger input	Min width of trigger pulse	10μ s					
	Camera Link input	LVDS : CC1 input	Camera Link connector				
(4) Serial	SerTC (Serial to Camera)	Camera Lir	nk input (LVDS)				
Communication	SerTFG (Serial to Frame Gra	abber) Camera Lir	nk output (LVDS)				
	White Clip Level	Digital 8bit :F	Fh				
(5) Video output signal	Setup Level	Digital 8bit :0	0h				
(-, -===================================	Dark Shading	Digital 8bit :u	nder $\pm 04$ h for both vertical and horizontal. (condition: gain 0dB)				

<sup>5</sup> seconds shall be waited after turning on power to get proper camera operation.


#### 5.3. CMOS Spectral Response (Representative value)

\*\*Lens characteristics and illuminant characteristics are not considered.

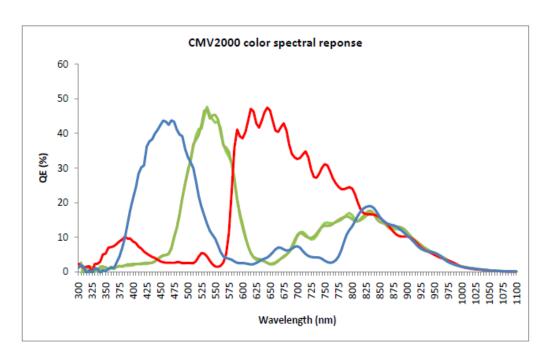

#### 5.4. Video Output Format

VGA 500fps Mode: 2Tap Interleaved Bayer Pattern: GBRG (At full frame scan)

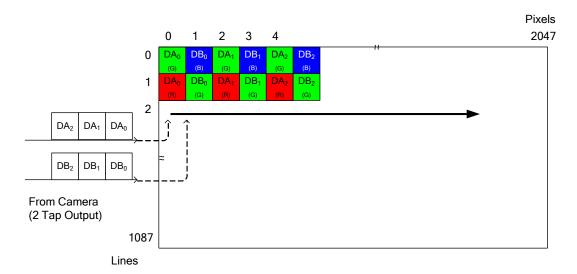

\* At manual partial scan mode, Bayer Pattern changes per 1 line according to the set vertical starting position value.

#### 5.5. Camera Link Port Data Bit Assignment (Base Configuration)

Port/bit	At 8bit output setting	At 10bit output setting
Port A0	DA:bit0[LSB]	DA:bit0[LSB]
Port A1	DA:bit1	DA:bit1
Port A2	DA:bit2	DA:bit2
Port A3	DA:bit3	DA:bit3
Port A4	DA:bit4	DA:bit4
Port A5	DA:bit5	DA:bit5
Port A6	DA:bit6	DA:bit6
Port A7	DA:bit7[MSB]	DA:bit7
Port B0	DB: bit0[LSB]	DA:bit8
Port B1	DB: bit1	DA:bit9[MSB]
Port B2	DB:bit2	Not in use
Port B3	DB:bit3	Not in use
Port B4	DB:bit4	DB:bit8
Port B5	DB:bit5	DB:bit9[MSB]
Port B6	DB:bit6	Not in use
Port B7	DB:bit7[MSB]	Not in use
Port C0	Not in use	DB:bit0[LSB]
Port C1	Not in use	DB:bit1
Port C2	Not in use	DB:bit2
Port C3	Not in use	DB:bit3
Port C4	Not in use	DB:bit4
Port C5	Not in use	DB:bit5
Port C6	Not in use	DB:bit6
Port C7	Not in use	DB:bit7

VCC-FC20V49PCL \_\_\_\_\_ Rev.900-734-33

#### 6. Function Settings

Camera functions can be set with serial data communications.


Function	Address	Data			
		0: 0 dB			
		1: +6 dB			
Gain	001	2: + 12 dB			
		3: Manual Gain (Refer to address 008.)			
		4~255: 0dB			
		0: 1/500s			
		1: 1/500s			
		2: 1/750s			
		3: 1/1000s			
		4: 1/1500s			
		5: 1/2000s			
Shutter		6: 1/2500s			
(at full frame scan mode)		7: 1/4000s			
(at ruii frame scarr mode)		8: 1/5000s			
※For partial scan mode,	002	9: 1/10000s			
please refer to Section 9.		10: 1/15000s			
picase refer to section 3.		11: 1/20000s			
		12: 1/25000s			
		13: 1/3000s			
		14: 1/4000s			
		15: 1/50000s			
		16: Manual Shutter (Refer to address 009&010.)			
		17~255: 1/500s			
		0: Through			
		1: 3200K			
White Balance	003	2: Spare			
		3: Spare			
		4: Manual White Balance (Refer to the Address 006&007.)			
		5~255: Through			
		0: Normal Shutter Mode (Trigger Shutter Mode OFF)			
		1: Fixed Trigger Shutter Mode			
Trigger Shutter Mode	004	(Shutter speed can be set with address 002.)			
Trigger enacted treat		2: Pulse Width Trigger Shutter Mode			
		(Shutter speed can be set with trigger pulse width.)			
		3~255: Normal Shutter Mode (Trigger Shutter Mode OFF)			
		0: Full Frame Scan Mode			
Scan Mode	005	1: Partial Scan Mode (Vertical 1/2)			
Scar Flode	003	2: Manual Partial Scan Mode (Refer to address 016/017 & 019/020.)			
		3~255: Full Frame Scan Mode			
Manual White Balance	006	$0\sim120$ : $0\sim+12$ dB $0.1$ dB/step $\%$ Make the data of Address 003 to 004.			
R Gain Control	000	121~255: +12dB			
Manual White Balance	007	$0\sim120$ : $0\sim+12$ dB $0.1$ dB/step $\%$ Make the data of Address 003 to 004.			
B Gain Control	007	121~255: +12dB			
Manual Cair Carden	000	$0\sim$ 120: $0\sim$ +12dB 0.1dB/step %Set the data of address 001 to 003.			
Manual Gain Control	008	121~255: +12dB			
		©2014 CIS Corporation. All rights received			

Function	Data					
		0~480: 1/50000s~1/500s				
		481~2047: 480				
		X The setting will be 1 line when 0 is set.				
		Exposure Time = The set value × 1line Time [s]				
Manual Shutter Control	009&010	1line Time [s] = ((output pixels/2tap)+5) × 1/79.99MHz				
		At full frame scan, output pixels = 480				
		1line Time ≒ 4.06µ s				
		※Address 002 data shall be 016.				
		Address 009 MSB and Address 010 LSB make 11bit in total.				
		0: Positive Input				
Tringer Delevity	011	1: Negative Input				
Trigger Polarity		2~255: Positive Input				
No Function	012	0: Fixed. Do not change.				
		0: 8bit output data (RAW)				
Output Data Selection	013	1: 10bit output data (RAW)				
		2~255: 8bit output data				
Trigger Input Signals	014	2: OFF				
Camera Internal H Sync ON/OFF	014	3: ON				
		0~Max. Value ※ 1line/step				
Marking I Barkin I Cons		*Max. value shall be limited according to the formula below.				
Vertical Partial Scan	016&017	480 (Vertical Partial Scan output max. lines – Vertical Partial Scan output lines)				
Start Position		※Address 005 data shalla be 002.				
		Address 016 MSB and Address 017 LSB make 11bit in total.				
		0~480: 1line/step Min.:1line/Max :480 lines				
Marking I Barkin I Cons		481~2047: 480				
Vertical Partial Scan	019&020	※ 1 line shall be set when 0 is set.				
Output Lines		Address 019 MSB and Address 020 LSB make 11bit in total.				
		*Address 005 data shalla be 002.				
		0: 9600bps				
		1: 19200bps				
Remote Communication	020	2: 38400bps				
Baud Rate Setting	030	3: 57600bps				
		4: 115200bps				
		5~255: 9600bps				
Data Save	032	Input 083 to save address 000 ~ 031 to EEP-ROM.				

#### 7. External Connector Pin Assignment


#### 7.1. 26pins Mini Camera Link Connector 12226-1100-00 PL (SUMITOMO 3M)

Pin No.		Pin No.	
1	DC +12V	14	GND
2	X0-	15	X0+
3	X1-	16	X1+
4	X2-	17	X2+
5	Xclk-	18	Xclk+
6	X3-	19	X3+
7	SerTC+	20	SerTC-
8	SerTFG-	21	SerTFG+
9	CC1- (Trigger IN-)	22	CC1+ (Trigger IN+)
10	CC2+	23	CC2-
11	CC3-	24	CC3+
12	CC4+	25	CC4-
13	GND	26	DC +12V

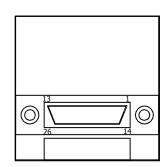


#### 8. Timing Chart

#### 8.1. Horizontal Synchronous Signal Timing

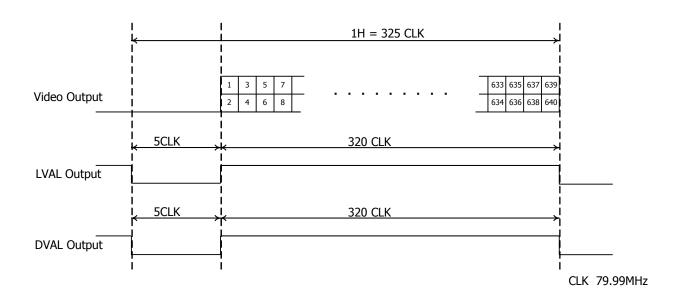

#### 8.2. Vertical Synchronous Signal Timing

#### 8.2.1 Full Frame Scan Mode

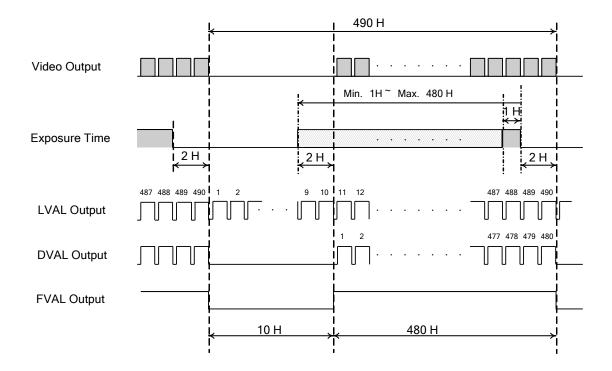

XVideo output signal delays by 2H from Exposure Time.

#### 8.2.2 Fixed Trigger Shutter Mode


☐ This is the mode to start exposure with external input trigger signals, and set the exposure time with serial commands.


- ☐ Trigger operation is CLK Sync. HV-Sync Reset. The delay time (Exposure Time Delay) from detecting trigger edge in the camera to starting exposure is approx. 330ns.
- ☐ Triggers can be accepted even when outputting video signals. However, trigger signals for exposure to start the next video output prior to the completion of video transmission for the prior video output signals cannot be accepted.

If the edge part of trigger signals is overlapped with video outputting period, 1 line noise may be detected on the video output screen. To input trigger signals during video output period, set the data 003 to the address 014 (Trigger input signal, camera internal H sync ON). External trigger signals are synchronized with camera internal H signals so that max. 1HD jitter to Exposure Time delay would occur.

☐ When changing the camera to fixed trigger shutter mode, the first output image can be unstable.

Please input the first trigger as a dummy to ignore and take the second and after as the actual triggers.

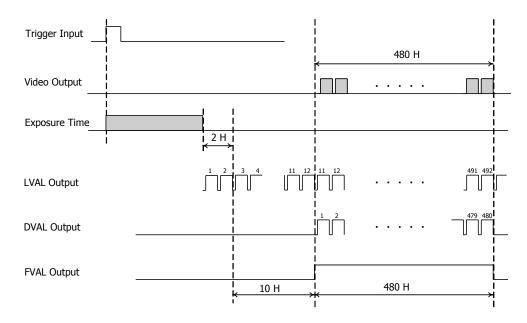

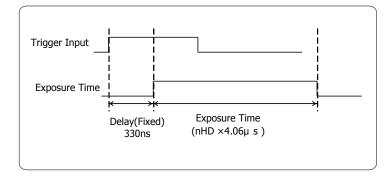

XVideo output signal delays by 2H from Exposure Time.

#### 8.2.3 Pulse Width Trigger Shutter Mode

☐ This is the mode to start exposure with external input trigger signals, and set the exposure time with pulse width of the trigger signals.


☐ Trigger operation is CLK Sync. HV-Sync Reset. The delay time (Exposure Time Delay) from detecting trigger edge in the camera to starting exposure is approx. 330ns. And, the delay time from detecting trigger end edge to completing exposure is approx. 270ns.


□ Pulse width is min. 1HD to approx. 2 frames. Functionally, there is no upper limitation, but noises such as dark noises and shadings may be noticeable at long time exposure.

☐ Triggers can be accepted even when outputting video signals. However, trigger signals for exposure to start the next video output prior to the completion of video transmission for the prior video output signals cannot be accepted.

If the edge part of trigger signals is overlapped with video outputting period, 1 line noise may be detected on the video output screen. To input trigger signals during video output period, set the data 003 to the address 014 (Trigger input signal, camera internal H sync ON). External trigger signals are synchronized with camera internal H signals so that max. 1HD jitter to Exposure Time delay would occur.

☐ When changing the camera to pulse width trigger shutter mode, the first output image can be unstable. Please input the first trigger as a dummy to ignore and take the second and after as the actual triggers.

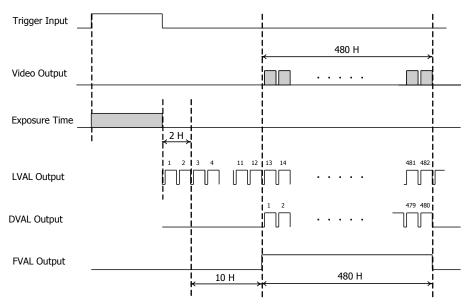


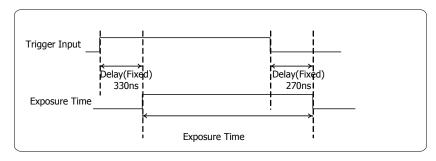

XVideo output signal delays by 2H from Exposure Time.

#### Partial Scan Mode

Vertical Partial Scan

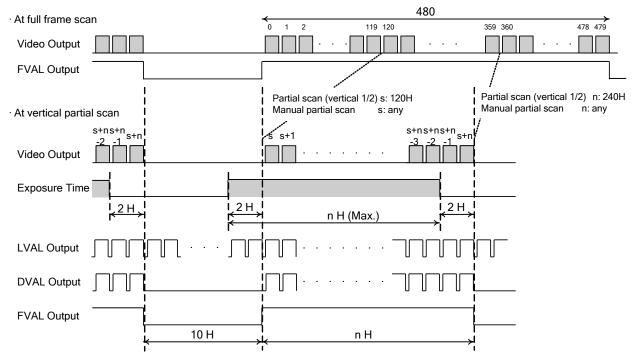

- s: Vertical partial scan starting position (address 016 & 017)
- n: Vertical partial scan output lines (address 019 & 020)


Scan Mode (address:005)	S	n	Vertical Sync. Frequency (Hz)
0:Full frame scan mode	0	480	502.29
1:Partial scan mode (Vertical 1/2)	120	240	984.49
2:Manual partial scan mode	Any	any	79.99MHz /((Vertical partial scan output lines +10)×(325))

<sup>•</sup>The max value of vertical partial scan starting position is limited with the formula below since vertical partial scan output line has priority.

The max value of vertical partial scan starting position

- =480(The max value of vertical partial scan output line) Vertical partial scan output lines
- (Ex.) When 400 is set as vertical partial scan output lines, the max value of vertical partial scan starting position will be 480-400 = 80.

If vertical partial scan starting position is set to 90 with this time, vertical partial scan output line has priority so that vertical partial scan starting position shall be limited to 80.

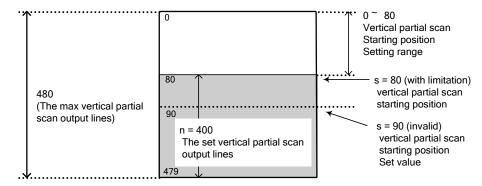

\* At manual partial scan mode, manual shutter value to be set shall meet the following conditions.

The set manual shutter lines  $\leq$  Vertical partial scan output lines

If the condition above is not met, shutter lines to be set will be the same number as vertical partial scan output lines.

#### 10. Remote Interface Function

Camera can be controlled by external computers and others via camera link interface.

(1) The settings for RS-232C are as follows.

Baud Rate : 9600bps,19200bps,38400bps,57600bps,115200bps

Data : 8bit
Stop bit : 1bit
Parity : None

XON/XOFF : not controlled

#### (2) Control code

The total control code is 14 bits, which conforms to ASCII code.

• The control code consists of camera No. process code, remote controller address, remote controller data, and CR. Execute Read/Write through PC, and the camera will reply the data.

1	2	3	4	5	6	7byte目	8	9	10	11	12	13	14
	Camera No.				Process code	Remote			Remote controller			CR	
				controller		ler data							
					ado	dress							
000	000000: Common No.			"R" Read mode	Please refer to			000~2	255				
				"W" Write mode	th	e ado	dress				0Dh		
Ded	Dedicated Camera No.		"C"Camera	ta	ble of	f 6.							
			mode	Fu	nctio	n							
					se	tting.	•						

#### Camera No

Please send the common code, "000000", consist of 6 bytes of characters/numeric strings.

The returned data from the camera shall be the dedicated camera No assinged for that specific camera.

#### Process code

Input any one of R, W, or C to the process code.

R (read mode) is to read the data of remote controller address.

Please be noted to set any dummy data ( $000\sim255$ ) to  $11^{th}\sim13^{th}$ , since a command shall consists of 14 bytes.

W (write mode) is to write the data to the remote controller address.

Please be noted that the data cannot be saved into EEPROM of the camera.

(Reboot the camera, and the data is reset to the initial setting.)

To save the data into EEPROM, please refer to Clause 5. Function Setting.

Note: Once the data was saved into EEPROM, it may not be reset to t he initial settings.

C is the code to send the data back from the camera.

Note: Do not set code C when sending the data from PC side.

#### Remote controller address

Note: Do not save the data into the address other than specified, since it may cause the damages or malfunction of the camera.

#### Remote controller data

Set the decimal number  $(000\sim255)$  for the remote controller data. Please be noted to set any dummy data at read mode.


#### CR

Be sure to input "CR" to confirm the end of the command.

#### 11. Initial Settings

Function	Address	Data			
Gain	001	0: 0dB			
Shutter	002	0: 1/500s			
White Balance	003	0: Through			
Trigger Mode	004	0: Normal Shutter Mode (Trigger Shutter Mode OFF)			
Scan Mode	005	0: Full Frame Scan Mode			
Manual White Balance	006	0: 0dB			
R Gain Control					
Manual White Balance	007	0: 0dB			
B Gain Control					
Manual Gain Control	008	0: 0dB			
Manual Shutter Control	009&010	480: 1/500s			
Trigger Polarity	011	0: Positive Input			
Output Data Selection	013	0: 8bit Output Data (RAW)			
Trigger Input Signals	014	2: OFF			
Camera Internal H Sync					
ON/OFF					
Baud Rate	030	0:9600bps			

#### 12. CMOS Optical Axis Accuracy

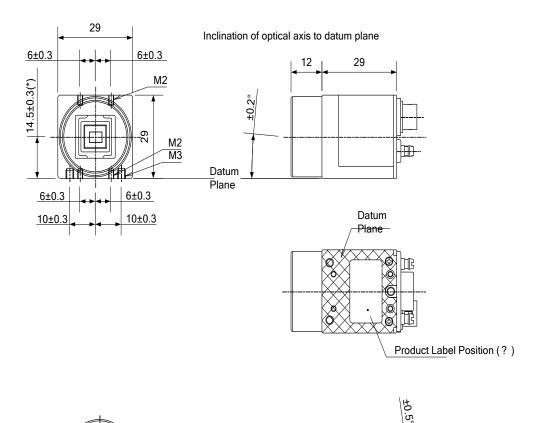


Inclination of effective pixels, Theta,?, to datum plane shall be ??  $\pm 0.5^{\circ}$  The center of effective pixels shall be within f 0.6 to the center of C lens mount

#### (\*) Dimensions from datum plane to the center of the lens mount

910-006-01-01 (Unit:mm)

#### 13. Dimensions

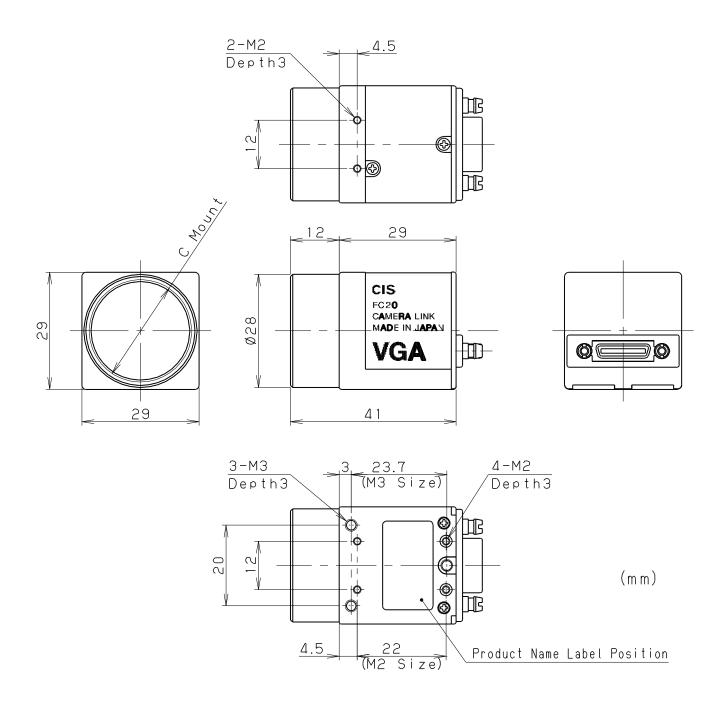

% C Mount screws comply with ANSI/ASME B1.1, 1-32UN(2B)

Screw length from C Mount lens suerface shall be under 6mm.
 And, protruding portion shall be less than 10mm.

935-0021-00

#### 14. Cases for Indemnity (Limited Warranty)

We shall be exempted from taking responsibility and held harmless for damage or losses incurred by the user in the following cases.

- ❖ In case damage or losses are caused by fire, earthquake, or other acts of God, acts by third party, deliberate or accidental misuse by the user, or use under extreme operating conditions.
- ❖ In case indirect, additional, consequential damages (loss of business interests, suspension of business activities) are incurred as result of malfunction or non-function of the equipment, we shall be exempted from responsibility for such damages.
- ❖ In case damage or losses are caused by failure to observe the information contained in the instructions in this product specification & operation manual.
- ♦ In case damage or losses are caused by use contrary to the instructions in this product specification & operation manual.
- In case damage or losses are caused by malfunction or other problems resulting from use of equipment or software that is not specified.
- In case damage or losses are caused by repair or modification conducted by the customer or any unauthorized third party (such as an unauthorized service representative).
- ♦ Expenses we bear on this product shall be limited to the individual price of the product.

#### 15. Sensor Pixel Defect

Sensor pixel defects might be noted with time of usage of the products.

Cause of the Sensor pixel defects is the characteristic phenomenon of CMOS itself and CIS is exempted from taking any responsibilities for them.

#### 16. Product Support

When defects or malfunction of our products occur, and if you would like us to investigate on the cause and repair, please contact your distributors you purchased from to consult and coordinate.

Camera control sample software (RS232C) is downloadable from our web but we shall be exempted from taking responsibility and held harmless for damage or malfunction of your hardware and software caused by using this control software. The purpose of the control software prepared is for you to check operation and evaluate our products. Please be noted that CIS does not customize the program nor provide source code.